


转造级滚珠丝杆形式与尺寸

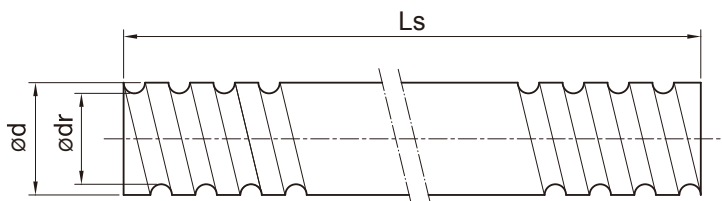

单位: mm

外径 d	型号		导程精度等级	螺纹方向		最长转造长度	丝杆编号
	导程	珠径 DW		L: 左 / R: 右	螺纹数		
8	1	0.8	C7,C8,C10	R	1	1000	R0801X
	2	1.2		R	1		R0802Y
	2.5	2		R	1		R08I2Z
10	2	1.588	C7,C8,C10	R	1	1000	R1002K
12	4	2.381	C5,C7,C8,C10	R	1	1500	R1204A
	5	2		R	1		R1205Z
	10	2		R	1		R1210Z
	12	2.381		R	2		2R1212A
14	4	2.381	C5,C7,C8,C10	R	1	3000	R1404A
	5	3.175		R	1		R1405B
15	5	3	C5,C7,C8,C10	R	1	3000	R1505V
	10	3		R	2		2R1510V
	10	3.175		R	2		2R1510B
	16	3		R	2		2R1516V
	20	3.175	C7,C8,C10	R	4	4R1520B	
16	4	2.381	C5,C7,C8,C10	R	1	3000	R1604A
	5	3.175		R	1		R1605B
	10	3.175		R	2		2R1610B
	16	3.175		R	2		2R1616B
20	4	2.381	C5,C7,C8,C10	R	1	3000	R2004A
	5	3.175		R	1		R2005B
	10	4.762		R	1		R2010D
	20	3.175		R	2		2R2020B
	40	3.175	C7,C8,C10	R	4	4R2040B	

单位: mm

型号		导程精度等级	螺纹方向 L: 左 / R: 右	螺纹数	最长转造长度	丝杆编号
外径 d	导程					
25	4	2.381	C5,C7,C8,C10	R	6000	R2504A
	5	3.175		R/L		R(L)2505B
	5.08	3.175		R/L		R(L)2515B
	10	3.175		R		2R2510B
	10	4.762		R		R2510D
	10	6.350		R		R2510F
	25	3.175		R		4R2525B
	25	3.969		R		4R2525C
28	5	3.175	C5,C7,C8,C10	R	6000	R2805B
	6	3.175		R		R2806B
32	5	3.175	C5,C7,C8,C10	R/L	6000	R(L)3205B
	5.08	3.175		R/L		R(L)3215B
	10	3.969		R		R3210C
	10	6.350		R		R3210F
	20	3.969		R		2R3220C
	20	6.350		R		2R3220F
	32	3.969		R		4R3232C
	32	4.762		R/L		4R(L)3232D
36	10	6.350	C5,C7,C8,C10	R	6000	R3610F
38	10	6.350	C5,C7,C8,C10	R	6000	R3810F
	20	6.350		R		2R3820F
	40	6.350		R		4R3840F
40	5	3.175	C5,C7,C8,C10	R	6000	R4005B
	10	6.350		R		R4010F
	20	6.350		R		2R4020F
	40	6.350		R		4R4040F
50	10	6.350	C5,C7,C8,C10	R	6000	R5010F
	20	6.350		R		2R5020F
	50	7.938		R		4R5050H
63	10	6.350	C7,C8,C10	R	6000	R6310F
	20	6.350		R		2R6320F
80	10	6.350	C7,C8,C10	R	6000	R8010F

规格定义

1 R 25 05 A -1000 C7



转造级滚珠丝杆螺帽

标准规格

FSIN



FSIW



FSDN



FSKW



FSDW



FSDU

